DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES Office of Structural Materials Quality Assurance and Source Inspection

Bay Area Branch 690 Walnut Ave.St. 150 Vallejo, CA 94592-1133 (707) 649-5453 (707) 649-5493



Contract #: 04-0120F4

Cty: SF/ALA Rte: 80 PM: 13.2/13.9

File #: 13.28

WELDING INSPECTION REPORT

Resident Engineer: Pursell, Gary **Report No:** WIR-008761 Address: 333 Burma Road **Date Inspected:** 01-Sep-2009

City: Oakland, CA 94607

OSM Arrival Time: 1100 **Project Name:** SAS Superstructure Prime Contractor: American Bridge/Fluor Enterprises, a JV **OSM Departure Time:** 1930

Contractor: Oregon Iron Works Clackamas, Or. **Location:** Clackamas, OR

CWI Name: Mike Gregson, Jose Salazar **CWI Present:** Yes No **Inspected CWI report:** Yes N/A **Rod Oven in Use:** Yes No No N/A Yes N/A **Electrode to specification:** No Weld Procedures Followed: Yes No N/A Yes N/A **Qualified Welders:** No **Verified Joint Fit-up:** Yes No N/A N/A Yes N/A **Approved Drawings:** Yes No **Approved WPS:** No **Delayed / Cancelled:** Yes No N/A

34-0006 **Bridge No: Component:** Hinge K Pipe Beams

Summary of Items Observed:

The Quality Assurance Inspector Sean Vance arrived on site at Oregon Iron Works, Inc (OIW) in Clackamas, OR, to randomly observe the in process welding of the Hinge K Pipe Beam assemblies. The QA Inspector arrived on site to randomly observe the OIW Quality Control (QC) Inspectors in process and completed visual and nondestructive testing. Upon the arrival of the QA Inspector the following observations were made:

OIW Fabrication Shop-Bay 3

Hinge-K Pipe Beam Assembly 102A-1: 9/1/09

all1-1 Forging to all0-1 Base Plate

QA Inspector noticed that OIW production personell were grinding and performing weld clean-up, on the PJP and fillet welds stiffeners to a111-1 forging and a107/b106 stiffeners. QA Inspector spoke with lead QC Inspector Mike Gregson and Mr. Gregson explained that OIW production personell continuing to blend the weld start/stops, removing weld spatter and repairing undersize welds in specific areas, which were previously marked by QC Inspector Jose Salazar. Mr. Gregson also explained that the completed fillet and PJP welds on the radial stiffeners, which were found to be visually acceptable per AWS D1.5 and contract requirements, were in process of 100% magnetic particle inspection by QC Inspector Jose Salazar. QA Inspector noted that the in-process visual and magnetic particle testing by OIW QC Inspectors appeared to be in compliance with AWS D1.5 and contract requirements.

Hinge-K Pipe Beam Assembly 102A-3: 9/1/09



WELDING INSPECTION REPORT

(Continued Page 2 of 3)

a111-3 Forging to a110-3 Base Plate

QA Inspector witnessed welder #H49, Mr. Rick Hinkle, was in process flux core arc welding (FCAW) "intertacking", on the various stiffener plates, in the vertical (3G) position. QA Inspector noted that these weld joints were designated as partial joint penetrations (AWS D1.5 TC-P5-S) and QA Inspector verified Mr. Hinkle was currently qualified for this process/position. QA Inspector noted that Mr. Hinkle was utilizing OIW approved welding procedure specification (WPS 3050) and randomly recorded pre-heat temperatures of approximately 350 degrees Fahrenheit. OA Inspector noticed OC Inspector Jose Salazar was present to monitor in-process welding parameters (amps/volts) and noted that Mr. Salazar had previously recorded in-process welding parameters of 240 amps and 25.2 volts. QA Inspector recorded random parameter measurements of 245 amps and 25.2 volts, which appears to be in compliance with the applicable welding procedure specification and contract requirements.

OIW Fabrication Shop-Bay 6 (ESW Overlay Process) Hinge-K Pipe Beam Fuse Assembly 120A-7: 9/1/09 a124-5 Half Fuse to a124-15 Half Fuse


QA Inspector noticed that the first/second ESW stainless steel overlay passes were complete and welder #F17, Mr. Igor Frolov, was in-process of depositing the third layer ESW passes (approximately 25% complete), on this fuse assembly 120A-7. QA Inspector noted that the first electro slag welding (ESW) passes were completed in the flat position, utilizing Soudokay brand Soudotape 309L stainless steel consumable strip and the second/third layer (in-process) electro slag welding (ESW) passes, utilizing Soudokay brand Soudotape 316L stainless steel consumable strip, per contract requirements. QA Inspector randomly noticed QC Inspector's Mike Gregson and Jose Salazar were present, to verify in-process welding parameters (amps/volts) and monitor in-process continuous pre-heat temperatures. QA Inspector spoke with QC Inspector Jose Salazar and Mr. Salazar explained that welding amps were recorded as 1200 amps/25.2 volts, travel speed at 241mm/min. and a pre-heat temperature recorded at 70 Fahrenheit (21 C). QA Inspector verified Mr. Igor Frolov was currently qualified for this welding process/position, verified amps/volts (1200/25.2) and randomly recorded pre-heat temperatures of approximately 70 Fahrenheit (21C). QA Inspector noted that Mr. Igor Frolov appeared to be in compliance with the applicable approved welding procedure specification (WPS 7003). See attached pictures below.

Material, Equipment, and Labor Tracking

QA Inspector Sean Vance performed a verification of material, personnel and equipment involved with the project. The QA Inspector observed at Oregon Iron Works: 6 OIW production personnel and 2 QC Inspectors. The QA Inspector observed at AG Machining: 1 Machinist using a horizontal lathe.

WELDING INSPECTION REPORT

(Continued Page 3 of 3)

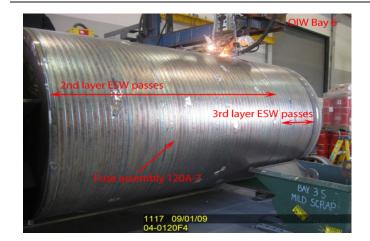



Summary of Conversations:

As noted above.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Mohammad Fatemi (916) 813-3677, who represents the Office of Structural Materials for your project.

| Inspected By: | Vance,Sean | Quality Assurance Inspector |
|---------------|------------|-----------------------------|
| Reviewed By: | Adame,Joe | QA Reviewer |